



Dart Hawkesbury
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D3582-1-BENT
Job Sheet 167200



Part No: D3582-1-BENT

Job Qty: 7 ea

Part Name: Skidtube Assembly BK117



Part Weight: 0 lbs

Status: Scheduled

Priority: Medium

Job Created: 10/26/17

Job Tracking No:

Due Date: 12/8/17

Created By: Victoria Michaud-Febrille

Type: SOLD

Description:

Note: SALES ORDER 658

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	7 Ea		12/7/17	0.00	0.00	Start up container		
110	CNC Bend Skidtubes	7 pcs		12/8/17	0.26	1.57	CNC Bend Skidtube		Mbvs 17-11-02
120	QC	7 pcs		12/8/17	0.00	0.00	QC5		
130	Packaging	7 pcs		12/8/17	0.00	0.00	Packaging3		DAS 21 NOV 09 2017
140	QC21-SA	7 Ea		12/8/17	0.00	0.00	QC21		

Part Op 110 - Bend tube as per program D3582 on CNC Bender and Dwg D3582. Folio 3, use bending aid DT9632 2- cut fwd end
Descriptions: of tube as per dwg
130 - LOCATION : LG002

Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	D2962-150	7	0	0	0
	B100121-1 D2962-190	7			

Part Specifications

Specifications could not be found.

Plex 10/27/17 1:33 PM dart.Michaud-Febrille.Victoria

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Dart Aerospace Ltd. 1270 Aberdeen Street Hawkesbury, ON K6A 1K7 CANADA TEL.: 1 613 632-5200 Email: sales@dartaero.com www.dartaerospace.com	D3582-1-BENT Start up Operation Mfg Date: 11/06/17 Job No: 167200	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="5" style="text-align: center;">AGAINST DEPARTMENT/PROCESS</th> </tr> <tr> <td style="width: 15%;">Work</td> <td style="width: 15%;">Skid-tube</td> <td style="width: 15%;">Cross tube</td> <td style="width: 15%;">Water Jet</td> <td style="width: 15%;">Engineering</td> </tr> <tr> <td>Trap</td> <td>Machining</td> <td>Small Fab</td> <td>Prod. Eng. Coord.</td> <td>Quality</td> </tr> <tr> <td>Is-is</td> <td>Thermoforming</td> <td>Finishing</td> <td>Rec/Store/Packaging</td> <td>Other</td> </tr> <tr> <td>ved</td> <td>Large Fab</td> <td>Composite</td> <td>Supplier</td> <td></td> </tr> <tr> <td colspan="4">QTY Effective :</td> <td>MRB (QSI042) Approval</td> </tr> <tr> <td colspan="4" rowspan="3" style="text-align: center; vertical-align: middle;">Disposition</td> <td>Completed By</td> </tr> <tr> <td>Lead hand / Supervisor Approval Verification</td> </tr> <tr> <td>QC / QA Coordinator Approval</td> </tr> </table>	AGAINST DEPARTMENT/PROCESS					Work	Skid-tube	Cross tube	Water Jet	Engineering	Trap	Machining	Small Fab	Prod. Eng. Coord.	Quality	Is-is	Thermoforming	Finishing	Rec/Store/Packaging	Other	ved	Large Fab	Composite	Supplier		QTY Effective :				MRB (QSI042) Approval	Disposition				Completed By	Lead hand / Supervisor Approval Verification	QC / QA Coordinator Approval
AGAINST DEPARTMENT/PROCESS																																							
Work	Skid-tube	Cross tube	Water Jet	Engineering																																			
Trap	Machining	Small Fab	Prod. Eng. Coord.	Quality																																			
Is-is	Thermoforming	Finishing	Rec/Store/Packaging	Other																																			
ved	Large Fab	Composite	Supplier																																				
QTY Effective :				MRB (QSI042) Approval																																			
Disposition				Completed By																																			
				Lead hand / Supervisor Approval Verification																																			
				QC / QA Coordinator Approval																																			
DART AEROSPACE S007117 Skidtube Assembly BK117 PART NO: Revision: Operation: Quantity: Change No:	<table border="1" style="width: 100%; border-collapse: collapse;"> <tr> <th colspan="3" style="text-align: center;">FAULT CATEGORY</th> </tr> <tr> <td style="width: 33%;"> ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes </td> <td style="width: 33%;"> ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center </td> <td style="width: 33%;"> ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence </td> </tr> </table>		FAULT CATEGORY			☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes	☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center	☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence																															
FAULT CATEGORY																																							
☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes	☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center	☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence																																					

ITEM	Qty -041	Part Number	Description
	X	D3582-041	SKIDTUBE ASSEMBLY
1	1	D2962-150	EXTRUSION
2	1	D2964	CAP
3	1	D2965	CAP
4	1	D2971	CROSS BOLT SPACER
5	1	D3508-3	WEARPLATE
6	1	D3508-9	WEARPLATE
7	1	D3508-11	WEARPLATE
8	1	D3508-13	WEARPLATE
9	1	D3558-3	GASKET
10	1	D3558-9	GASKET
11	1	D3558-11	GASKET
12	1	D3558-13	GASKET
13	1	D3584-1	WEB
14	3	D3662-1	CROSS BOLT SPACER
15	1	D3662-3	CROSS BOLT SPACER
16	2	D5304-1	CROSS BOLT SPACER
17	2	D5520-1	DOUBLER
18	28	AN3C4A	BOLT
19	2	AN3-5A	BOLT
20	2	AN4-4A	BOLT
21	28	NAS1149C0332R	WASHER (AN960C10L)
22	2	NAS1149D0332J	WASHER (AN960JD10L)
23	2	NAS1149D0416J	WASHER (AN960JD416L)
24	36	AELS-1032-130	INSERT
25	2	ALS7-428-165	INSERT
26	68	CR3212-5-05	CSK RIVET, CHERRY MAX

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION COAT PER QSI 005 4.1 PRIOR TO INSERTING D3584-1 WEB. POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3. ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: N/A
- 7) WEIGHT: 18.2 lbs
- 8) WELDING: PER DART QSI 004.
- 9) INSERT D3584-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
- 10) USE DART DRILL TEMPLATE DT8900 TO LOCATE AND DRILL Ø0.297 HOLES (36 PLACES) FOR WEARSHOE INSERTS. INSTALL AELS-1032-130 PER SECTION G-G (36 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/-291.
- 11) DO NOT INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS IN INDICATED LOCATIONS
- 12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309. COUNTERSINK Ø0.286 x 100° (34 PL) PER DOUBLER AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS.

RELEASED
2017-08-11
EN 17-547

E	MOVE VIEWS FROM SHT 1 TO SHT 2. ADD ITEMS 17 & 26 AND NOTE 12-13. Ø0.167 HOLE WAS Ø0.75. ADD SHT 3, ADD DETAIL J. SECTION F-F ADD D5520-1. SCALE ON VIEWS WAS 3X.	AJS	17.03.27
D	D5304-1 WAS D2973; REVISE BOM & SECTION F-F & SECTION NOTES (ZN B7-3, A8-3); REF NCR16-6160	RF	17.01.09
C	D3492 PLUG ASSEMBLIES REMOVED. REFORMAT NOTES SHT 1	AP	15.11.02
B	29.86 WAS 29.87 (ZN C2-1), INCORPORATED DEO D3582-A-1 (ZN D5-1), FORMAT TO CURRENT STD	RF	15.02.20
A	NEW ISSUE	PH	07.08.08
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC EUGENE, OR	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D3582	SHEET 1 OF 4
APPROVED		TITLE	SCALE
DE APPR.	#	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMBOD OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

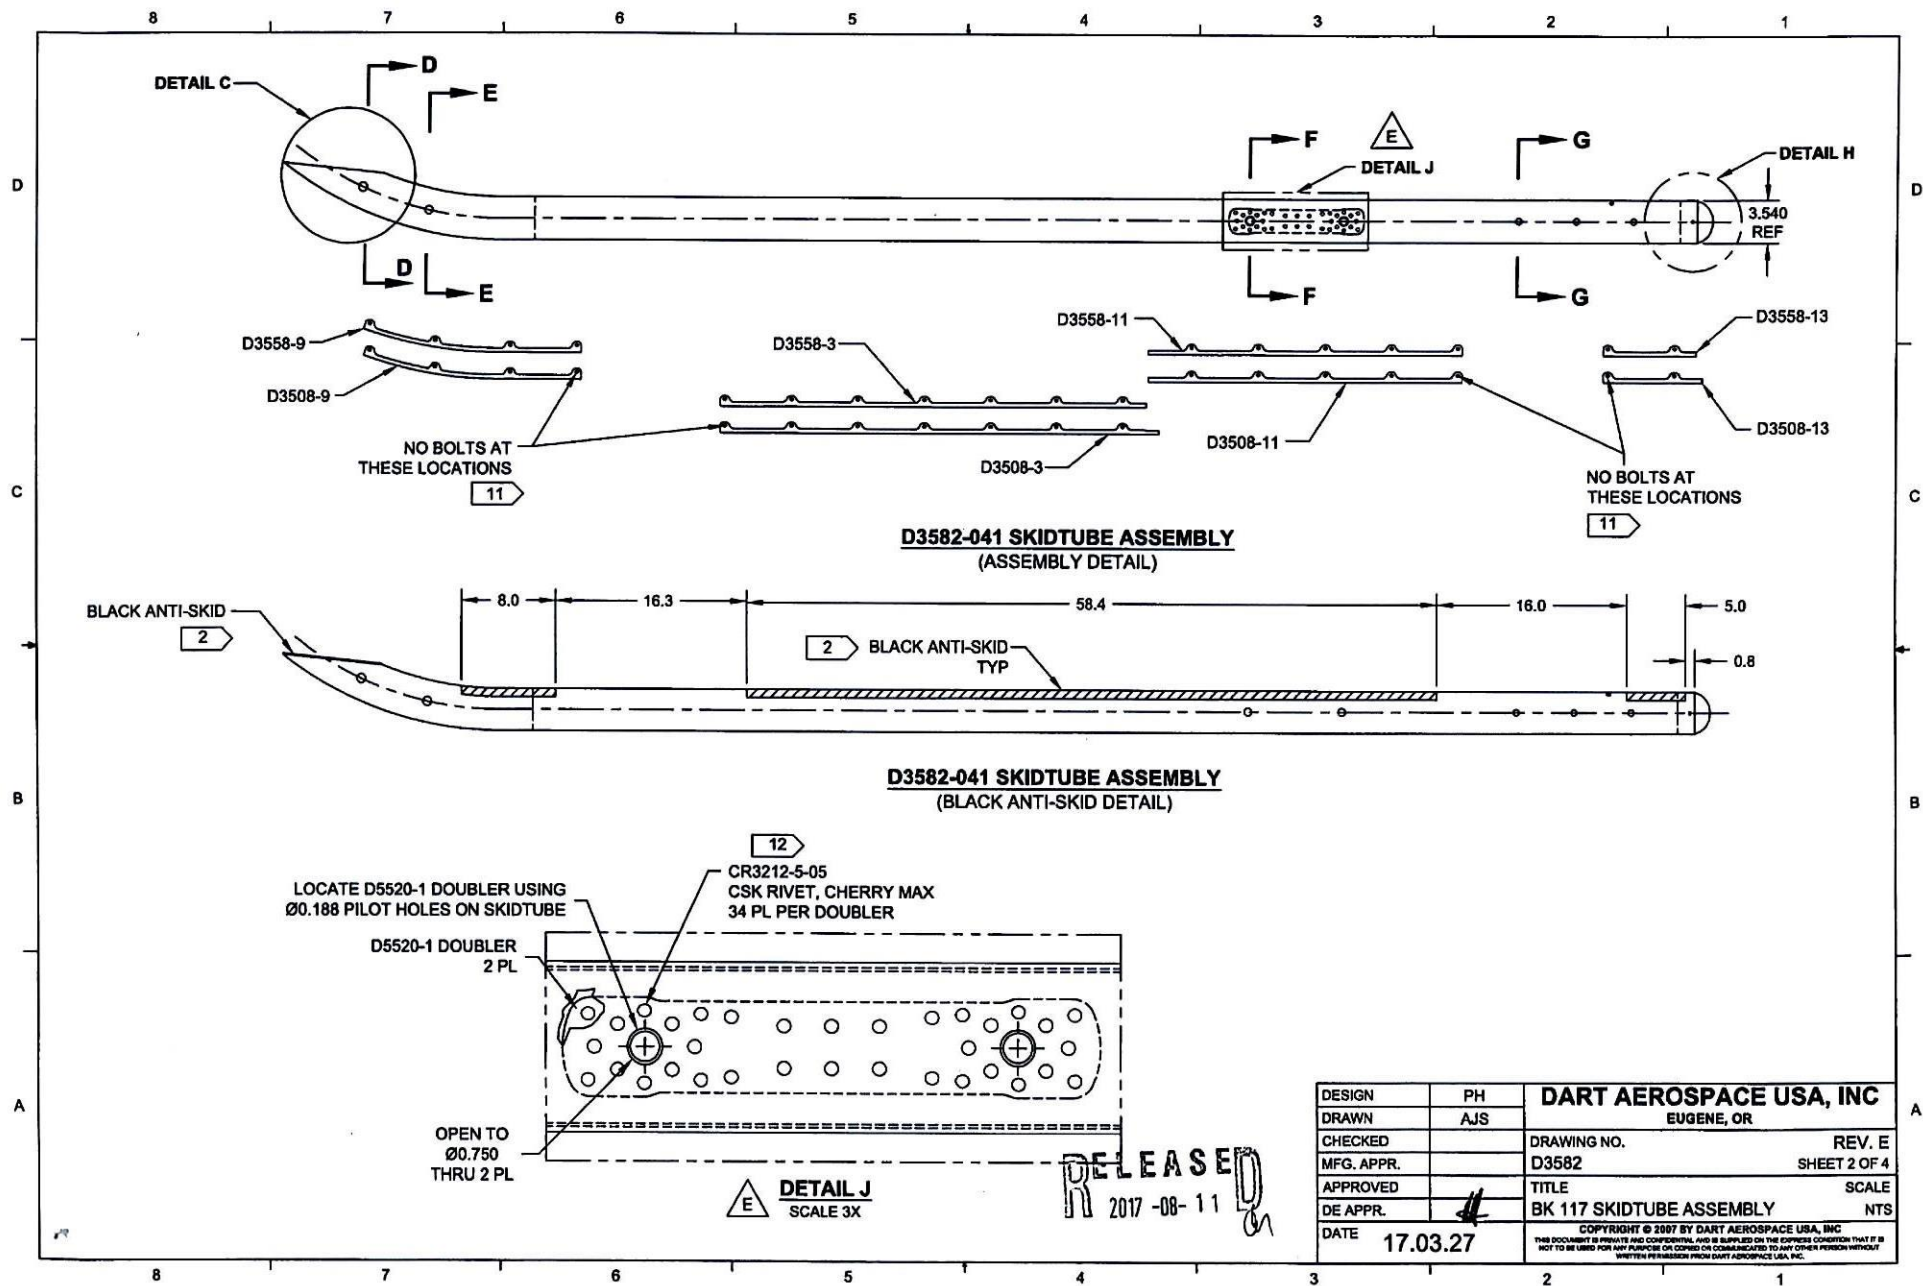

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					

Root Cause				FAULT CATEGORY			
Environment ☐	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
Design ☐	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
Doc/Data ☐	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
Equip/Tooling ☐	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
Handling/Pre ☐	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
Material ☐	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
Internal Transport ☐	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
Tribal Knowledge ☐	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
LOA ☐	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
Substation ☐	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
Past Expiry Date ☐	☐ Manufacturing Process	OTHER : _____					
Misidentified ☐	☐ Past Due						

D2964 CAP
(GRIND FLUSH)

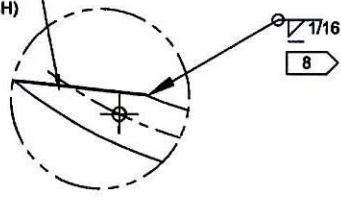


DETAIL C
SCALE 4X

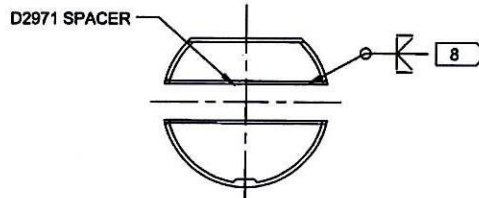


SECTION D-D
SCALE 4X

- SECTION D-D NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D2971 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.750 DRILL TO REMOVE SPILL OVER

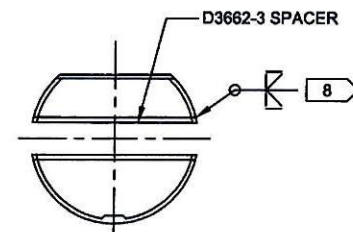


SECTION E-E
SCALE 4X

- SECTION E-E NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D3662-3 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.672 DRILL TO REMOVE SPILL OVER

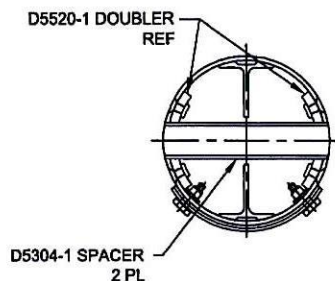


SECTION F-F
SCALE 4X
2 PL

- SECTION F-F NOTES**
AFTER BENDING AND DRILLING ASSY
PERFORM THE FOLLOWING:
1. INSERT D5304-1 SPACER
 2. SWAGE TO Ø0.565 +0.005/-0.000 X 1.0 DEEP PER QSI 002
 3. OPEN THRU HOLE TO Ø0.625
 4. GRIND FLUSH

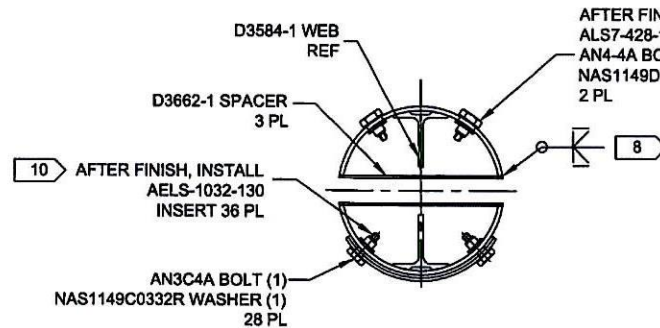

SECTION G-G
SCALE 4X

- SECTION G-G NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D3662-1 SPACER (3 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.515 DRILL TO REMOVE SPILL OVER

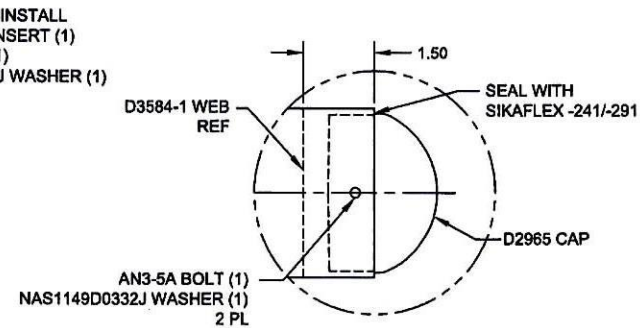

DETAIL H
SCALE 4X

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D3582	SHEET 3 OF 4
APPROVED		TITLE	SCALE
DE APPR.		BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

RELEASED
2017-08-11

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

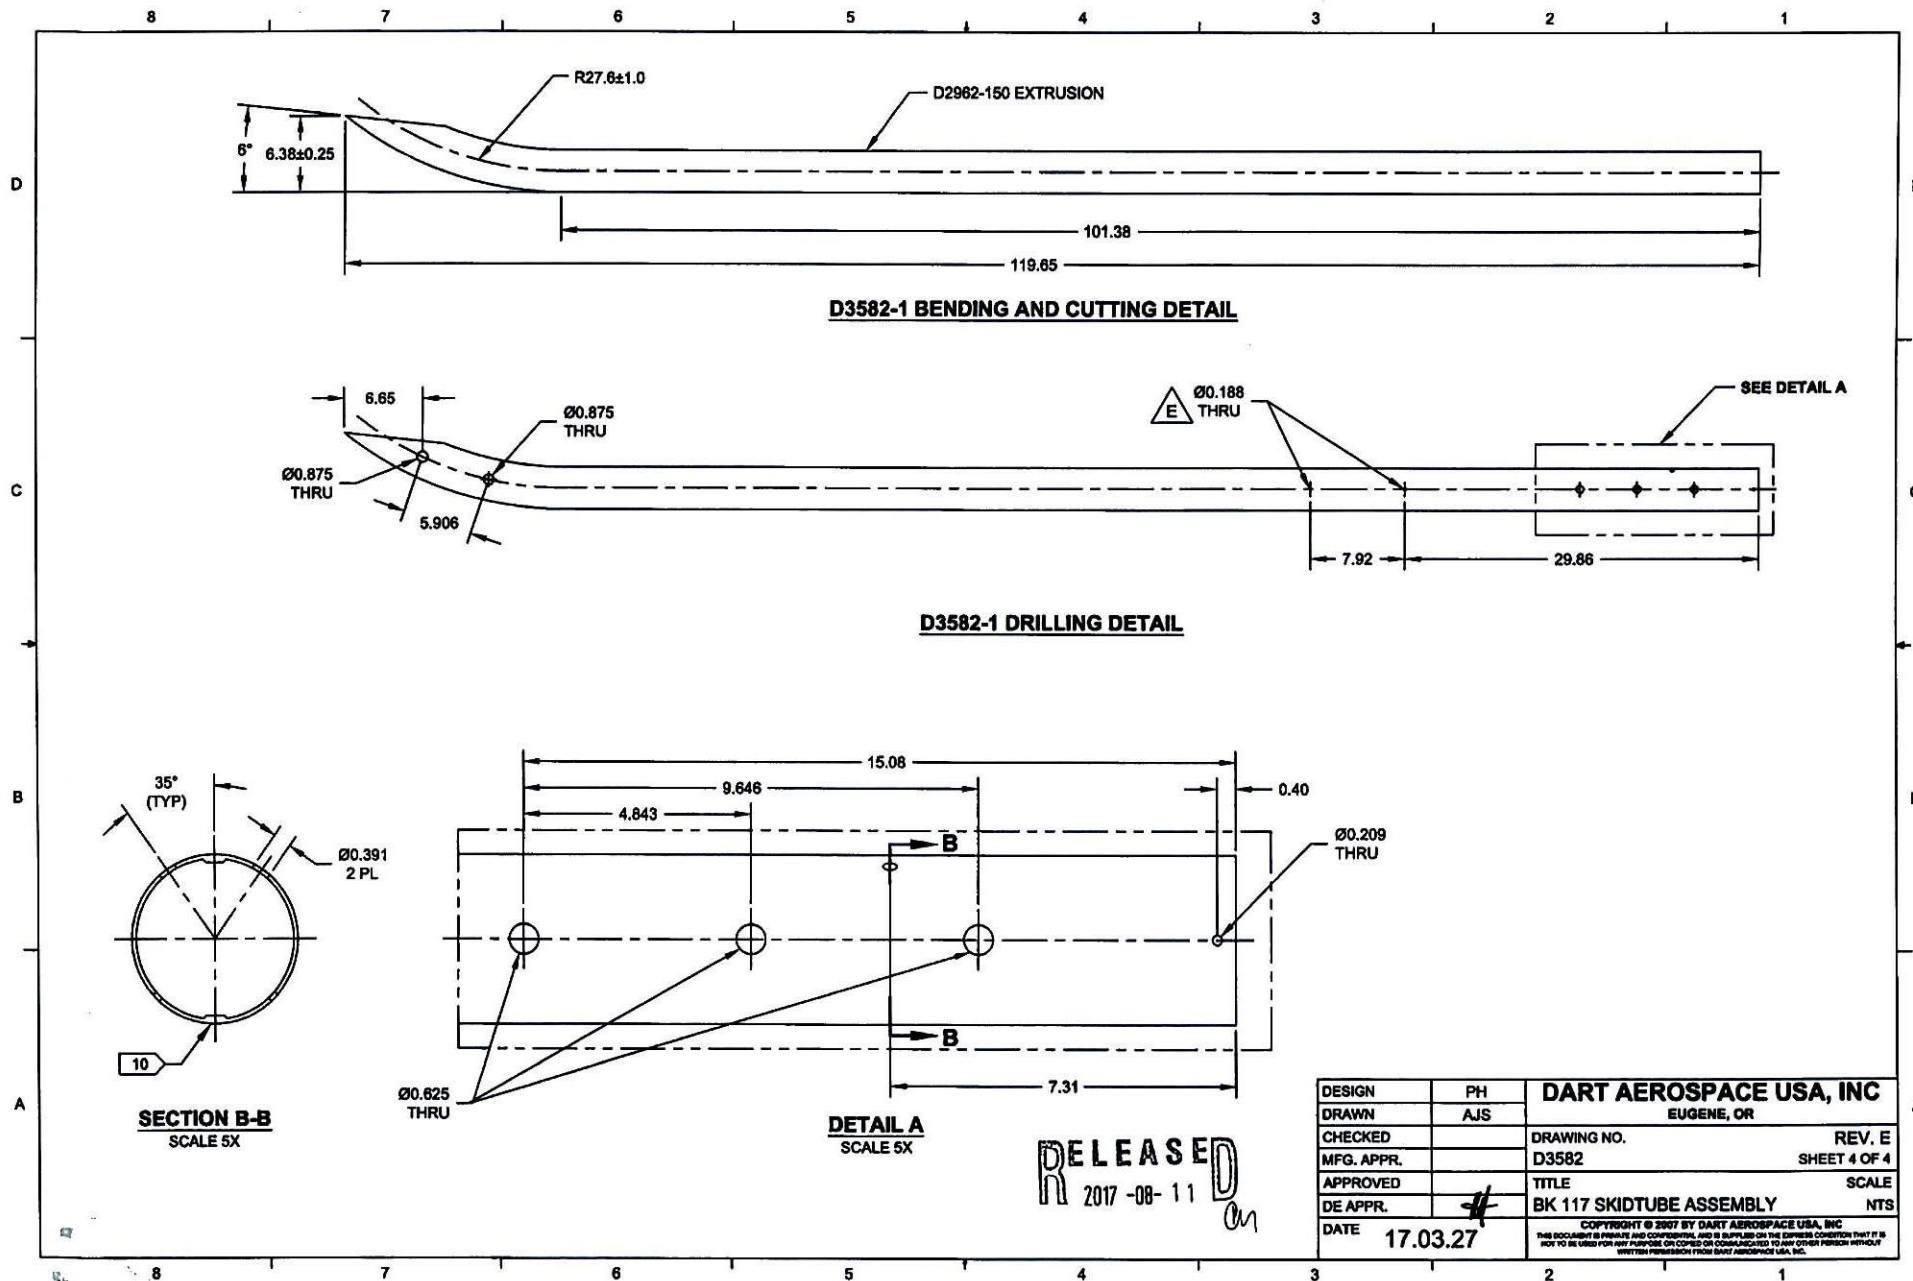

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			